SENATE BUSINESS & INDUSTRY
EXHIBIT NO. 6
DATE 1/21/05
BILL NO. SB 211

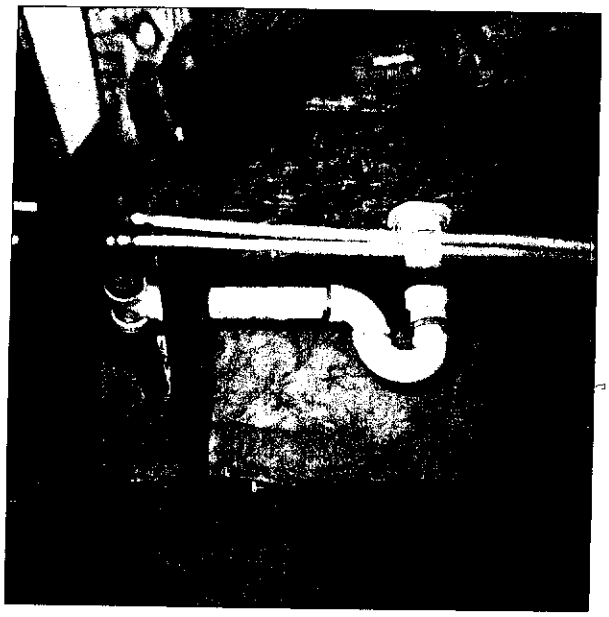

SHOWER DRAIN IMPROPERLY VENTED
VENT IS ON THE SAME LEVEL AS THE
DRAIN SO VENT WILL GET PLUGGED AND
DRAIN WON'T WORK RIGHT. DRAIN SHOULD
ALSO BE 2". THIS IS 1½"

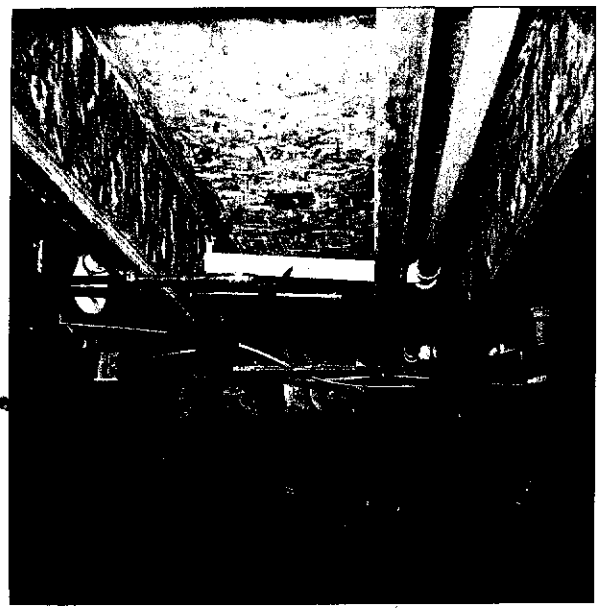

WHIRLPOOL TUB DRAIN IS NOT VENTED
AT ALL. SHOULD ALSO BE 2". THIS
IS 1½. ALSO NOTICE PIPE IS NOT
SUPPORTED FOR FULL LENGTH OF FLOOR
JOIST.

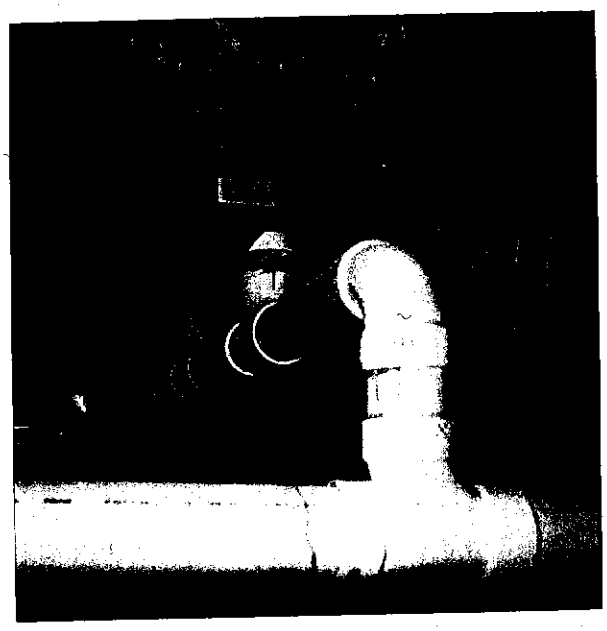

2 TOILETS BACK TO BACK IMPROPERLY VENTED. THEY ALSO TIE INTO MAIN DRAIN WITH A TEE. IT SHOULD BE A WYE OR SWEEP FITTING

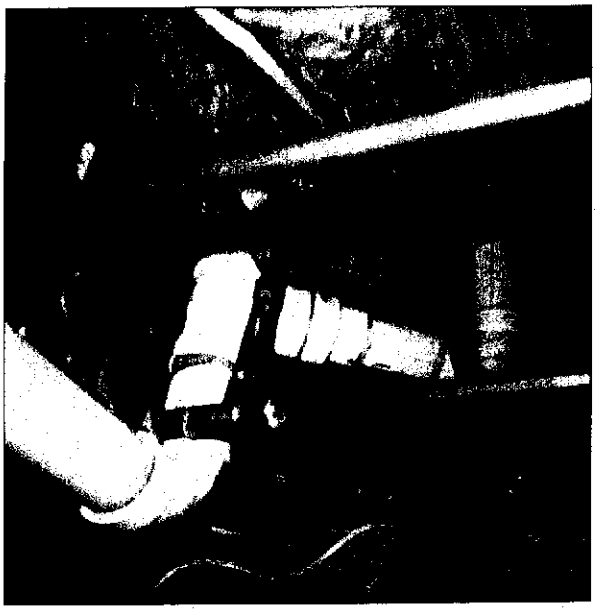

THIS IS A WASHING MACHINE DRAIN. THE VENT IS TIED IN BELOW THE FLOOR. IT SHOULD BE TIED IN ABOVE THE FLOOR.

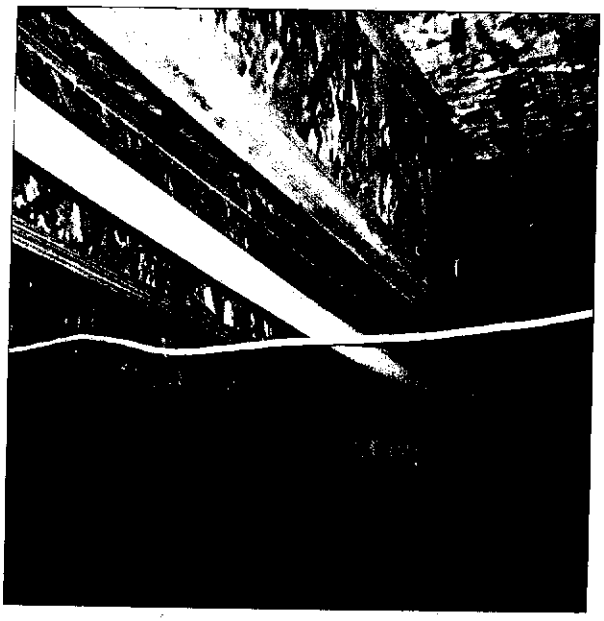

KITCHEN SINK DRAIN. WAS NOT SUPPORTED IN 10' - SHOULD BE EVERY 4'. IT WAS BOWED WAY DOWN BELOW THE FLOOR JOIST. IT TOO SHOULD BE 2". THIS ONE IS 1½"

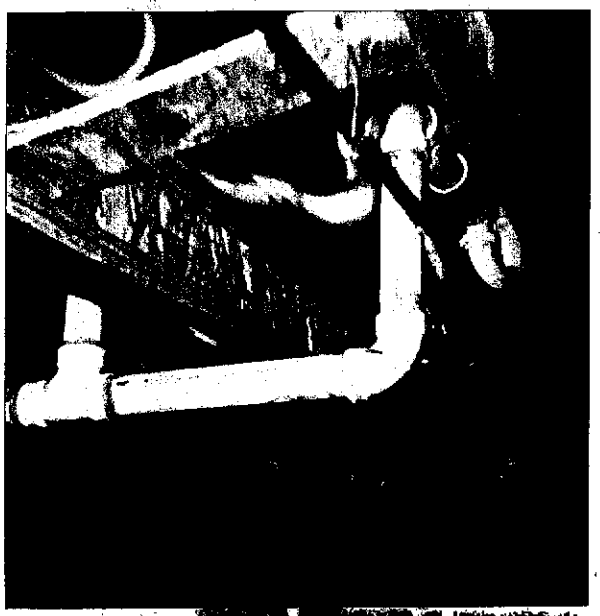

TUB DRAIN IS IMPROPERLY VENTED. IT SHOULD ALSO BE PIPED IN 2", THIS IS 1½".

[redacted]
[redacted] 6
DATE 8/21/05
[redacted] 98211